

401532

GC Performance Classics

748 Fesslers Lane
Nashville, TN. 37210
Phone: 615-818-0594 Fax: 629-888-4965
PASSION FOR EXCELLENCE

REPAIR ORDER #

000026

Org. Est. # 000026

REPAIR ORDER - RO

Scheduled : 11/10/2016 12:08 PM

Print Date : 11/11/2016

Daniel Schmitt & Co. - Nelson, Kevin

3455 N. Lindbergh Blvd.
Saint Ann, MO 63074

Office: 314-291-7000

Cust ID : 18

Last Service : 01/01/1970

Cur. Odometer : 0

1994 Jaguar - XJ220 - 3.5L twin turbo V6

Lic # : -

VIN # :

Hat # JOB 1628 MFG Date : 11/10/2016


Prev. Odometer : 0

Elapsed Mileage : 0

Labor Requested / Part SubTotal

Extended

LABOR ESTIMATED ONLY, PARTS SUPPLIED BY CUSTOMER AT TIME OF QUOTE. Take delivery of car, remove doors and full interior	1,600.00
Parts Subtotal:	0.00
Place car on lift, pull rear windscreen, and remove front trunk, apply body protectors.	200.00
Remove heater matrix, wiper motor assembly and arms	800.00
Remove front and rear valence, motor cover	200.00
Drain all fluids	200.00
Prep engine for removal and drop from chassis	1,200.00
Engine disassembly, remove transaxle from engine	800.00
Fuel system overhaul, including fuel lines, fuel cell/bladder, all seals/gaskets, transmitter, filters, fuel inj.hose at engine, pressure regulators, fuel pumps PARTS SUPPLIED BY CUSTOMER	3,000.00
RECOMMEND Oil system overhaul involves removing teardown of cooling system and AC system in order to access all lines	1,800.00
RECOMMEND Cooling system overhaul, flush system, ALSO RECOMMEND REPLACING 2 timing belts.	600.00
Brake system service/ Overhaul, fluid change, possibly caliper overhauls, pads and brake hose replaced	1,600.00
Clutch work - clutch slave cylinder, clutch hose, clutch master cylinder and clutch replacement PART SUPPLIED BY CUSTOMER	400.00
RECOMMEND A/C system, drain system and service with new seals and possibly hoses	800.00
Possible tire replacement?	600.00
Reassembly, reinstall engine / drivetrain	2,400.00
Reinstall interior/body components	2,000.00
Test drive/and shake down car	800.00
Shop Supplies	200.00

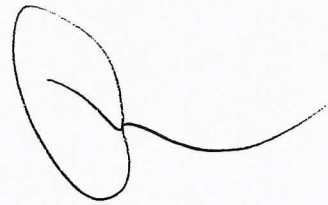

Parts: 0.00

Supplies: 200.00

Labor: 19,000.00

Tax:

Total: \$ 20,976.00

TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within ___ days of the date shown above if I choose not to authorize the service recommended. All Parts removed will be discarded unless instructed otherwise: Save all Parts _____. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

Authorized By _____

Date _____ Time _____

406532

GC Performance Classics

748 Fesslers Lane
 Nashville, TN. 37210
 Phone: 615-818-0594 Fax: 629-888-4965
 PASSION FOR EXCELLENCE

INVOICE

26

Org. Est. # 000026

Printed: 01/06/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18
 3455 N. Lindbergh Blvd.
 Saint Ann, MO 63074
 Office : 314-291-7000

1994 Jaguar - XJ220 - 3.5L twin turbo V6
 Lic #: R142V00 - Odometer In : 8636
 Unit #: 230
 VIN #: SAJJEAX8 AX220628 Hat #: JOB 1628

Part Description	Number	Qty	Sale	Ext	Labor Description	Hours	Ext
Added garagekeepers coverage insurance <i>INSGKPS</i>		2.00	120.75	241.50	LABOR ESTIMATED ONLY, PARTS SUPPLIED BY CUSTOMER AT TIME OF QUOTE. Take delivery of car, remove doors and full interior	16.00	1,600.00
Xtra seal- rubber talc <i>14-550</i>		1.00	8.98	8.98	11/12/16 Take delivery of car and tow into shop, along with boxes of loose parts		
International shipping/insurance water pumps <i>SHPG</i>		1.00	297.49	297.49	11/14/16 Place car on slow charger as key was left on during transport and run battery flat. Check in shipped parts and place on shelf		
Shop Supplies				129.30	11/22/16 Install body protector covers. Remove doors, back glass, and began removal of interior trim panels		
					11/23/16 start making parts list for car by groups		
					11/28/16 Continue removal of interior, seats, dash, console, radio, amp, 2nd and 3rd covers. organize all and place on shelves, clean up interior of vehicle		
					Place car on lift, pull rear windscreen, and remove front trunk, apply body protectors.	2.00	200.00
					12/1/16 Using block ramps, place car on lift. Install remaining body protectors and proceed with tear down for service.		
					Remove heater matrix, wiper motor assembly and arms		0.00
					Remove front and rear valence, motor cover	3.00	300.00
					12/6/16 Remove rear belly pan, rear wheels, and R&L rear inner wheel arches. Remove grill and rear bumper cover. Organize and place all on shelf.		
					Drain all fluids	2.00	200.00
					12/7/16 Drain sump pump oil, drain oil pan. Remove oil pump screen. Clean screen, R&R O-ring seal. Reinstall screen assembly and plug.		
					12/8/16 Drain coolant at engine. Remove wheels and place on rack. Open caliper bleeders and drain brake fluid.		
					Prep engine for removal and drop from chassis	18.00	1,800.00
					12/8/16 Remove inner front wheel arches. Remove air intake box and hose assemblies. Remove throttle cable to plenums. Remove muffler, drain transmission, remove sump and screen. Clean springs and magnets. Reassemble unit O-rings as obtained. Remove R&L air intake pipes. Disconnect and remove battery. Disconnect engine ground and harness connectors. Disconnect sump line to rack. Disconnect fuel return hose. Remove air cleaner tube assembly. Disconnect trans. link and pinch bolt, disconnect emergency brake cables. Disconnect AC hoses and removed from compressor. Removed both coolant hoses/elbows.		
					12/14/16 Remove clutch and brake hoses, drained clutch fluid, remove R&L turbo tubes/hoses to inner cooler. Remove crankcase breather, brake and clutch connection, upper coolant hoses, vacuum hoses/tee, and coolant rail pipes. Relevel car on lift prepping for engine removal.		
					12/15/16 Completed remove of E-brake cables, front pivot bolts and engine carriage, and all motor plate mounting bolts. Inspect and remove rear x-frame mounting hardware prior to engine/transaxle removal. Unbolt one transmitter harness and rear cross brace. Remove engine from chassis on scissor table lift.		

POSTED
 BY: MIA | DATE: 1-9-17

GC Performance Classics

748 Fesslers Lane
 Nashville, TN. 37210
 Phone: 615-818-0594 Fax: 629-888-4965
 PASSION FOR EXCELLENCE

INVOICE

26

Org. Est. # 000026

Printed: 01/06/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18
 3455 N. Lindbergh Blvd.
 Saint Ann, MO 63074
 Office : 314-291-7000

1994 Jaguar - XJ220 - 3.5L twin turbo V6
 Lic #: R142V00 - Odometer In : 8636
 Unit #: 230
 VIN #: SAJJEAEX8 AX220628 Hat #: JOB 1628

Part Description	/ Number	Qty	Sale	Ext	Labor Description	Hours	Ext
					Clean chassis, engine bay, and underbody covers as needed during tear down and reassembly. 12/6/16 Wash and clean center and rear engine and underbody covers, free of oils, debris. 12/16 Begin wipe down/clean of engine bay.	4.00	220.00
					Compile complete parts list needed for scope of work. 12/27-12/28 Work on compiling list of parts needed for service of car, in addition to what was previously recieved from customer.	10.00	550.00
					Engine disassembly, remove transaxle from engine 12/15/16 Remove spark plugs, perform compression test on engine. Cap off all open orifices of engine as needed to seal up. plugged off exposed tubes/oil lines, etc. 1/3/17 Remove both water pumps, loosen A/C compressor to complete B bank. Water pumps boxed up and shipped off for rebuild, Don Law.	6.00	600.00
					Fuel system overhaul, including fuel lines, fuel cell/bladder, all seals/gaskets, transmitter, filters, fuel inj.hose at engine, pressure regulators, fuel pumps PARTS SUPPLIED BY CUSTOMER 1/3/17 Remove fuel filter hoses from pumps, open up system and start to drain fuel cell. Drain approx. 1/2 gal. of fuel. Remove foam sound material. Remove fill neck from tank. Remove snap ring and start unbolt cover of cell. Having some fuel still inside, as output is plugged with foam debris. Siphon the fuel, and removed severly deteriorated foam. Remove inner fuel tank assembly and set aside to air dry. Siphon more fuel and sponge out remaining. Remove cell bladder, soak up fuel and allow to dry. Note date code on cell of 1994, original fuel bladder for car. 1/4/17 Remove fittings and hardware from fuel bladder itself, clean and set aside. Remove primer pumps from tank, test and install new ones. Clean sump primer tank fully prior to install new pumps. Loctite all elect. connections. R&R two fuel strainers on tubes. Test an draw out foam sections in cell to be cut for these pipes and equipment. Cut as needed, and set aside until more parts are received.	12.00	1,200.00
					RECOMMEND Oil system overhaul involves removing teardown of cooling system and AC system in order to access all lines 12/16/16 Removed right emissions tank. Remove right intercooler. Removed hoses from corresponding tank and intercooler, clean and set aside. Remove intercooler shield. 1/3/17 Remove oil tank, clean and set aside.	4.00	400.00
					RECOMMEND Cooling system overhaul, flush system, ALSO RECOMMEND REPLACING 2 timing belts. 1/4/17 Start removing radiator, cooling fans, and hoses. 1/5/17 Continue removal of cooling fans, hoses at radiator. test fans once they are removed. check good. remove front lower body cover to access to other components. Most of valence hardware is damaged and will be replaced. Continue draining of cooling system at this time. Disconnect hoses from oil cooler, drain oil, thoroughly clean coolers.	8.00	800.00

GC Performance Classics

748 Fesslers Lane
 Nashville, TN. 37210
 Phone: 615-818-0594 Fax: 629-888-4965
 PASSION FOR EXCELLENCE

INVOICE

26

Org. Est. # 000026

Printed: 01/06/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18
 3455 N. Lindbergh Blvd.
 Saint Ann, MO 63074
 Office : 314-291-7000

1994 Jaguar - XJ220 - 3.5L twin turbo V6
 Lic # : R142V00 -
 Unit # : 230
 VIN # : SAJJEAX8 AX220628

Odometer In : 8636
 Hat # : JOB 1628

Part Description	Number	Qty	Sale	Ext	Labor Description	Hours	Ext
					Remove lower front coolant tubes for radiator. Remove washer tank support bkt and tank, empty, rinse, set aside. Finish cleaning lower tubes, tank bkt, and shelf parts as needed.		
					Brake system service/ Overhaul, fluid change, possibly caliper overhauls, pads and brake hose replaced		0.00
					Clutch work - clutch slave cylinder, clutch hose, clutch master cylinder and clutch replacement PART SUPPLIED BY CUSTOMER		0.00
					RECOMMEND A/C system, drain system and service with new seals and possibly hoses	4.00	400.00
					1/5/17 Disconnect high and low side hoses from Evaporator unit. Install blanking caps on Evaporator. Remove screws and cover to forward AC control panel and remove assembly. Unhook AC leads here. Remove wiper arm, wiper link transmission and place on shelf.		
					Reassembly, reinstall engine / drivetrain		0.00
					Reinstall interior/body components		0.00
					Test drive/and shake down car		0.00
					Quote paint/body repair for front valence (driver's side), underbody front cover and dents on bonnet. PDR recommended on the bonnet, see below. NO work completed. Customer to have work done locally.		0.00
					Perform painless dent removal on bonnet of car, small dents noted on check in delivery of car, and notified customer as needed. 12/27/16		350.00

Org. Estimate 20,976.00 Revisions 0.00 Current Estimate 20,976.00

Labor:	8,620.00
Parts:	677.27
SubTotal:	9,297.27
Tax:	
Total:	10,157.27
Bal Due:	\$5,157.27

[Payments - Check (#69604) - \$5,000.00]

Vehicle Received: 11/14/2016

Work Completed Date: 11/16/2016

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____ Time _____

406532

GC Performance Classics
748 Fesslers Lane
Nashville, TN. 37210
Phone: 615-818-0594 Fax: 629-888-4965
PASSION FOR EXCELLENCE

POSTED
BY MIA DATE 2/16/17

INVOICE
26

Org. Est. # 000026

Printed: 02/15/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18	1994 Jaguar - XJ220 - 3.5L twin turbo V6
3455 N. Lindbergh Blvd.	Lic # : R142V00 - Odometer In : 8636
Saint Ann, MO 63074	Unit # : 230
Office : 314-291-7000	VIN # : SAJJEAEX8 AX220628 Hat # : JOB 1628

Part Description	/ Number	Qty	Sale	Ext	Labor Description	Hours	Ext
Added garagekeepers coverage insurance INSGKPS		3.00	120.75	362.25	LABOR ESTIMATED ONLY, PARTS SUPPLIED BY CUSTOMER AT TIME OF QUOTE. Take delivery of car, remove doors and full interior	16.00	1,600.00
Xtra seal- rubber talc 14-550		1.00	8.98	8.98	11/12/16 Take delivery of car and tow into shop, along with boxes of loose parts		
International shipping/insurance water pumps SHPG		1.00	297.49	297.49	11/14/16 Place car on slow charger as key was left on during transport and run battery flat. Check in shipped parts and place on shelf		
Castrol SRF racing brake fluid 1lt. 12512		2.00	89.99	179.98	11/22/16 Install body protector covers. Remove doors, back glass, and began removal of interior trim panels		
Castrol EDGE Gold 10W-60 synthetic oil 1L 12535		10.00	16.39	163.90	11/23/16 start making parts list for car by groups 11/28/16 Continue removal of interior, seats, dash, console, radio , amp, 2nd and 3rd covers. organize all and place on shelves, clean up interior of vehicle		
shipping and handling fuel rail cleaning SHPG		1.00	26.70	26.70	Place car on lift, pull rear windshield, and remove front trunk, apply body protectors.	2.00	200.00
sonic cleaning of fuel rails CLNFR		1.00	75.60	75.60	12/1/16 Using block ramps, place car on lift. Install remaining body protectors and proceed with tear down for service.		
M12-1.75 nylock nuts 1140171		8.00	1.20	9.60	Remove heater matrix, wiper motor assembly and arms		0.00
Shop Supplies				200.00	Remove front and rear valence, motor cover	3.00	300.00
					12/6/16 Remove rear belly pan, rear wheels, and R&L rear inner wheel arches. Remove grill and rear bumper cover. Organize and place all on shelf.		
					Drain all fluids	2.00	200.00
					12/7/16 Drain sump pump oil, drain oil pan. Remove oil pump screen. Clean screen, R&R O-ring seal. Reinstall screen assembly and plug.		
					12/8/16 Drain coolant at engine. Remove wheels and place on rack. Open caliper bleeders and drain brake fluid.		
					Prep engine for removal and drop from chassis	18.00	1,800.00
					12/8/16 Remove inner front wheel arches. Remove air intake box and hose assemblies. Remove throttle cable to plenums. Remove muffler, drain transmission, remove sump and screen. Clean springs and magnets. Reassemble unit O-rings as obtained. Remove R&L air intake pipes. Disconnect and remove battery . Disconnect engine ground and harness connectors. Disconnect sump line to rack. Disconnect fuel return hose. Remove air cleaner tube assembly. Disconnect trans. link and pinch bolt, disconnect emergency brake cables. Disconnect AC hoses and removed from compressor. Removed both coolant hoses/elbows.		
					12/14/16 Remove clutch and brake hoses, drained clutch fluid, remove R&L turbo tubes/hoses to inner cooler. Remove crankcase breather, brake and clutch connection, upper coolant hoses, vacuum hoses/tee, and coolant rail pipes. Relevel car on lift prepping for engine removal.		
					12/15/16 Completed remove of E-brake cables, front pivot bolts and engine carriage, and all motor plate mounting bolts. Inspect and remove rear x-frame mounting hardware prior to engine/transaxle removal. Unbolt one transmitter harness and rear cross brace. Remove engine from chassis on scissor table lift.		

GC Performance Classics

748 Fesslers Lane
 Nashville, TN. 37210
 Phone: 615-818-0594 Fax: 629-888-4965
 PASSION FOR EXCELLENCE

INVOICE

26

Org. Est. # 000026

Printed: 02/15/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18
 3455 N. Lindbergh Blvd.
 Saint Ann, MO 63074
 Office : 314-291-7000

1994 Jaguar - XJ220 - 3.5L twin turbo V6

Lic # : R142V00 -

Odometer In : 8636

Unit # : 230

VIN # : SAJJEAX8 AX220628

Hat # : JOB 1628

Part Description	/ Number	Qty	Sale	Ext	Labor Description	Hours	Ext
					Clean chassis, engine bay, and underbody covers as needed during tear down and reassembly. Clean parts as needed during mechanical restoration.	8.00	440.00
					12/6/16 Wash and clean center and rear engine and underbody covers, free of oils, debris.		
					12/16 Begin wipe down/clean of engine bay.		
					2/1/17 Washed and wiped down engine girdle, and hardware, L&R hubs in parts washer, along with numerous engine hardware, clean shocks.		
					2/2/17 Washed/cleaned Bank A & Bank B and misc. hardware, also cleaned A&B intake manifolds with Hardware		
					Compile complete parts list needed for scope of work.	10.00	550.00
					12/27-12/28 Work on compiling list of parts needed for service of car, in addition to what was previously recieved from customer.		
					Engine disassembly, remove transaxle from engine	29.50	2,950.00
					12/15/16 Remove spark plugs, perform compression test on engine. Cap off all open offices of engine as needed to seal up. plugged off exposed tubes/oil lines, etc.		
					1/3/17 Remove both water pumps, loosen A/C compressor to complete B bank. Water pumps boxed up and shipped off for rebuild, Don Law.		
					1/30/17 Remove thermostat housing, fuel regulator. Remove aux belt idler pulley. Remove harness from 2 sensors and loom restraints from B bank head. Remove A&B lower injector rails. remove hoses and injectors from rail and set aside. Remove upper hoses and injector from rails and set aside, remove cap and plug wires. Test wires for proper ohms range. Wires are in need of replacement. Bag all parts and shelf. Remove R&L turbo cooling tubes, rinse out and set aside.		
					1/31/17 Degrease and inspect turbo coolant rail tubes, set aside. Order secondary ign parts as needed. Test cap and rotor ohmatically and set aside. Shelf parts. Remove fuel pressure regulator from thermostat housing mounts. Bag all parts and set aside. Remove R and L side rear hubs, brake discs, half shafts, and positioning plates with hardware, remove sway bar and end links, removed right and left shocks, remove slave cylinder and starter, take off rear drivetrain plate, removed rear brake hoses and tee, Unbolt trans-cooler, and remove trans-axle tent girdle		
					2/1/17 unbolted lower A-frame Rand L, and misc brakets, removed tent girdle pillars, remove shift linkage, remove all housing bolts and pull transaxle from engine. clean drive train cradle rails.		
					Fuel system overhaul, including fuel lines, fuel cell/bladder, all seals/gaskets, transmitter, filters, fuel inj.hose at engine, pressure regulators, fuel pumps	21.50	2,150.00
					PARTS SUPPLIED BY CUSTOMER		
					1/3/17 Remove fuel filter hoses from pumps, open up system and start to drain fuel cell. Drain approx. 1/2 gal. of fuel. Remove foam sound material. Remove fill neck from tank. Remove snap ring and start unbolt cover of cell. Having some fuel still inside, as output is plugged with foam debris. Siphon the fuel, and removed severly deteriorated foam. Remove inner fuel tank assembly and set aside to air dry. Siphon more fuel and sponge out remaining. Remove cell bladder, soak up fuel and allow to dry. Note date code on cell of		

GC Performance Classics

748 Fesslers Lane
 Nashville, TN. 37210
 Phone: 615-818-0594 Fax: 629-888-4965
 PASSION FOR EXCELLENCE

INVOICE

26

Org. Est. # 000026

Printed: 02/15/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18
 3455 N. Lindbergh Blvd.
 Saint Ann, MO 63074
 Office : 314-291-7000

1994 Jaguar - XJ220 - 3.5L twin turbo V6

Lic # : R142V00 -

Odometer In : 8636

Unit # : 230

VIN # : SAJJEAX8 AX220628

Hat # : JOB 1628

Part Description	/ Number	Qty	Sale	Ext	Labor Description	Hours	Ext	
					1994, original fuel bladder for car. 1/4/17 Remove fittings and hardware from fuel bladder itself, clean and set aside. Remove primer pumps from tank, test and install new ones. Clean sump primer tank fully prior to install new pumps. Loctite all elect. connections. R&R two fuel strainers on tubes. Test an draw out foam sections in cell to be cut for these pipes and equipment. Cut as needed, and set aside until more parts are received. 1/13/17 Remove Left engine coolant rail to trans cooler. Remove idle air control hose to plenums. Remove 2 fuel line and 2 out hoses from upper injector rails. remove upper fuel rails and plenums. Remove B-bank unit, and start A-bank unit. Fuel hose and conn. were galded, diff to remove. Cut harness strap on A bank to remove. 1/16/17 Dissassemble A-bank plenum to remove seized loom mounting screw, reassemble unit, torque and set aside. Remove A & B bank intakes. Remove A-bank coolant pipe over cam cover. Block off 6 intake head ports.			
					RECOMMEND Oil system overhaul involves removing teardown of cooling system and AC system in order to access all lines 12/16/16 Removed right emissions tank. Remove right intercooler. Removed hoses from corresponding tank and intercooler, clean and set aside. Remove intercooler shield. 1/3/17 Remove oil tank, clean and set aside.	4.00	400.00	
					RECOMMEND Cooling system overhaul, flush system, ALSO RECOMMEND REPLACING 2 timing belts. 1/4/17 Start removing radiator, cooling fans, and hoses. 1/5/17 Continue removal of cooling fans, hoses at radiator. test fans once they are removed. check good. remove front lower body cover to access to other components. Most of valence hardware is damaged and will be replaced. Continue draining of cooling system at this time. Disconnect hoses from oil cooler, drain oil, thoroughly clean coolers. Remove lower front coolant tubes for radiator. Remove washer tank support bkt and tank, empty , rinse, set aside. Finish cleaning lower tubes, tank bkt, and shelf parts as needed.	8.00	800.00	
					Brake system service/ Overhaul, fluid change, possibly caliper overhauls, pads and brake hose replaced 1/12/17 Drain brake fluid from all 4 calipers. Remove all for rebuilding. Noted LF brake pad sensor is damaged and needs replaced. Have ordered new. 1/13 Remove brake pads, support struts and hardware from calipers. Bag and set aside. 1/30/17 Remove nut, bolt and alignment bushings from brake pedal for master cylinder removal, remove master cylinder and drain fluid from resovoir, remove top plate of brake booster box.	5.00	500.00	
					Clutch work - clutch slave cylinder, clutch hose, clutch master cylinder and clutch replacement PART SUPPLIED BY CUSTOMER 1/30/17 Removed nut, bolt and alignment bushings for clutch master cylinder. remove master cylinder and drained fluid from resovoir.	8.00	800.00	

GC Performance Classics

748 Fessler Lane
 Nashville, TN. 37210
 Phone: 615-818-0594 Fax: 629-888-4965
 PASSION FOR EXCELLENCE

INVOICE

26

Org. Est. # 000026

Printed: 02/15/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18
 3455 N. Lindbergh Blvd.
 Saint Ann, MO 63074
 Office : 314-291-7000

1994 Jaguar - XJ220 - 3.5L twin turbo V6
 Lic # : R142V00 -
 Unit # : 230
 VIN # : SAJJEAE8 AX220628

Odometer In : 8636
 Hat # : JOB 1628

Part Description	/ Number	Qty	Sale	Ext	Labor Description	Hours	Ext
					2/1/17 After pulling transaxle from form engine, removed clutch and found pilot bearing was severly worn. will replace. cleaned threads of clutch bolts, cleaned clutch threads in flywheel. Installed new AP racing clutch, applying loctite to all bolts to flywheel.		
					2/2/17 thoroughly cleaned inside bell housing on transaxle, and cleaned clutch fork.		
					RECOMMEND A/C system, drain system and service with new seals and possibly hoses	8.00	800.00
					1/5/17 Disconnect high and low side hoses from Evaporator unit. Install blanking caps on Evaporator. Remove screws and cover to forward AC control panel and remove assembly. Unhook AC leads here. Remove wiper arm, wiper link transmission and place on shelf.		
					1/30/17 Remove 2 oil drain lines, remove 2 cooling hoses, removed 3 AC lines and remove entire AC system for maintenance. removed 3 condensor drip tubes		
					Reassembly, reinstall engine / drivetrain		0.00
					Reinstall interior/body components		0.00
					Test drive/and shake down car		0.00
					Quote paint/body repair for front valence (driver's side), underbody front cover and dents on bonnet. PDR recommended on the bonnet, see below.		0.00
					NO work completed. Customer to have work done locally.		
					Perform paintless dent removal on bonnet of car, small dents noted on check in delivery of car, and notified customer as needed. 12/27/16		350.00

Org. Estimate 20,976.00 Revisions 0.00 Current Estimate 20,976.00

Labor:	13,840.00
Parts:	1,324.50
SubTotal:	15,164.50
Tax:	
Total:	16,567.22
Bal Due:	\$6,409.95

[Payments - Check (#69804, #69784) - \$10,157.27]
 Vehicle Received: 11/14/2016

Work Completed Date: 11/16/2016

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____ Time _____

406532

GC Performance Classics

748 Fesslers Lane
Nashville, TN. 37210
Phone: 615-818-0594 Fax: 629-888-4965
PASSION FOR EXCELLENCE

POSTED

BY *MIA* DATE *3-30-17*

INVOICE

53

Org. Est. # 000064

Printed: 03/26/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18
3455 N. Lindbergh Blvd.
Saint Ann, MO 63074
Office : 314-291-7000

1994 Jaguar - XJ220 - 3.5L twin turbo V6
Lic # : R142V00 -
Unit # : 230
VIN # : SAJJEAX8 AX220628

Odometer In : 8636
Hat # : JOB 1628

Part Description	Number	Qty	Sale	Ext	Labor Description	Hours	Ext
Alum. crush washer 3/8 Pk. 3278-03		1.00	13.38	13.38	Parts procurement for the project, through Don Law of England, etc. 3/1/17 GC Check in parts from initial Don Law order, delivery #1, sort and shelf as needed. 3/21/17 GC, JC review complete parts list still outstanding and begin to source parts from other vendors as available, including Jaguar of England	9.00	585.00
Alum. crush washer 3/4 Pk. 3278-08		1.00	17.38	17.38			
Philidas nut 10mm YZ-10MM		8.00	3.68	29.44			
12mm Alum. crush washer Pk. 3278-M12		1.00	13.38	13.38			
Fedex duties/Tax- Don Law order#1 FEDEX		1.00	213.25	213.25			
Added garagekeepers coverage insurance INSGKPS		2.00	120.75	241.50			
Shop Supplies				8.78			

Org. Estimate 1,225.91 Revisions 0.00 Current Estimate 1,225.91

Labor:	585.00
Parts:	537.11
SubTotal:	1,122.11
Tax:	
Total:	1,225.91
Bal Due:	\$1,225.91

[Payments -]
Vehicle Received: 3/26/2017

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____ Time _____

406532

GC Performance Classics
 748 Fesslers Lane
 Nashville, TN. 37210
 Phone: 615-818-0594 Fax: 629-888-4965
 PASSION FOR EXCELLENCE

POSTED

BY: MIA DATE 5-1-17

INVOICE

64

Org. Est. # 000076

Printed: 04/20/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18
 3455 N. Lindbergh Blvd.
 Saint Ann, MO 63074
 Office : 314-291-7000

1994 Jaguar - XJ220 - 3.5L twin turbo V6
 Lic # : R142V00 -
 Unit # : 230
 VIN # : SAJJEAEX8 AX220628

Odometer In : 8636
 Hat # : JOB 1628

Part Description	I Number	Qty	Sale	Ext	Labor Description	Hours	Ext
Hose assembly No. 8 A/C discharge 4201AB		1.00	293.11	293.11	Parts procurement for the project, sourcing from manufacturers in the states and UK, as needed.	16.00	880.00
Hose assembly, regulator to rail A-bank S21.013AB		1.00	175.00	175.00		3/23/17 GC JC Review components not received from Don Law and source form original or alternate manufacturer as available.	
Hose assembly S.23.021AC		1.00	173.20	173.20	3/29/17 GC Review and compare hoses that have been received from Don Law. Group hoses as needed to send out for remanufacture. Also remove additional hoses from engine that were already ordered, yet not received from DL. Continue this to prep hoses to be shipped out for remanufacturing.		
Hose assembly, turbo water S.23.019AC		2.00	164.24	328.48			
Oil hose, cooler inlet 5550AB		1.00	207.09	207.09	Clean underbody of monocoque, and polish aluminum support plate at front boot area. Also, clean and detail all 4 wheels while off car. 3/22/17	2.25	123.75
Hose assembly S.23.022AC		1.00	173.20	173.20	BF		
Oil hose, cooler exit 5551AB		1.00	207.09	207.09			
Oil hose 5546AB		1.00	171.47	171.47			
Oil breather hose 5549AA		1.00	179.74	179.74			
Hose assembly (stainless steel) S.50.013AD		1.00	190.52	190.52			
Hose assembly (stainless steel) S.50.012AD		1.00	190.52	190.52			
Brake hose, RH (stainless w/heat sleeve) 5234AB		1.00	186.78	186.78			
Brake hose, LH (stainless w/heat sleeve) 5228AC		1.00	186.78	186.78			
Flex pipe hose (stainless w/ heat sleeve) 5001AC		1.00	176.41	176.41			
Brake hose, FT (stainless w/ heat sleeve) 5241AB		2.00	158.77	317.54			
Trans oil hose 5498AA		1.00	183.19	183.19			
Trans oil hose 5497AA		1.00	183.19	183.19			
Hose assembly S.19.031AA		1.00	238.15	238.15			
Oil breather hose 5548AB		1.00	171.47	171.47			
Oil breather hose 5547AA		1.00	176.41	176.41			
AP racing master cylinder, rebuild CP3627		1.00	317.30	317.30			

GC Performance Classics
 748 Fesslers Lane
 Nashville, TN. 37210
 Phone: 615-818-0594 Fax: 629-888-4965
 PASSION FOR EXCELLENCE

INVOICE

64

Org. Est. # 000076

Printed: 04/20/2017

INVOICE

Daniel Schmitt & Co. - Nelson, Kevin #18
 3455 N. Lindbergh Blvd.
 Saint Ann, MO 63074
 Office : 314-291-7000

1994 Jaguar - XJ220 - 3.5L twin turbo V6
 Lic # : R142V00 -
 Unit # : 230
 VIN # : SAJJEAEX8 AX220628

Odometer In : 8636
 Hat # : JOB 1628

Part Description	Number	Qty	Sale	Ext	Labor Description	Hours	Ext
Added garagekeepers coverage insurance INSGKPS		1.00	120.75	120.75			
Fedex duties/Tax- Don Law order#2 FEDEX		1.00	135.00	135.00			
Fedex shipping charges 2 day air, hoses, brake hydraulics FEDEX		3.00	55.75	167.25			
Shop Supplies				15.06			

Org. Estimate 1,942.28 Revisions 0.00 Current Estimate 1,942.28

Labor:	1,003.75
Parts:	4,864.70
SubTotal:	5,868.45
Tax:	542.83
Total:	6,411.28
Bal Due:	\$6,411.28

[Payments -]
 Vehicle Received: 4/12/2017

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____ Time _____